

# **OPERATIONAL MANUAL**

---

MODEL: **TYP-28A** MAGNETIC DRILLING MACHINE

---



**by BLUEROCK® Tools**

---

### UNPACKING THE ITEM

Caution: This machine is packed together with items that may be sharp, oily and overly heavy objects. Remove the machine from the packaging in a safe manner. Check to ensure all accessories are included with the item while unpacking. If any parts are found to be missing, contact the retailer as soon as possible. Do not throw away the packaging until the item is out of the guarantee period. Dispose of the packaging in an environmentally responsible manner. Recycle if possible. Keep all plastic bags away from children due to risk of suffocation.



WEEE - Waste Electrical & Electronic Equipment. Note this machine should be disposed of as electrical & electronic waste.

## Table of Contents

<b><u>SAFETY</u></b>	<b><u>1</u></b>
<b><i>PRE-OPERATIONAL SAFETY CHECKS</i></b>	<b><i>1</i></b>
<b><i>OPERATIONAL SAFETY CHECKS</i></b>	<b><i>1</i></b>
<b><u>SPECIFICATIONS</u></b>	<b><u>4</u></b>
<b><u>INCLUDED ACCESSORIES</u></b>	<b><u>4</u></b>
<b><u>ADDITIONAL AVAILABLE ACCESSORIES</u></b>	<b><u>5</u></b>
<b>ADDITIONAL ACCESSORIES FOR THIS MACHINE CAN BE FOUND IN <b>BLUEROCK®</b> TOOLS ONLINE SHOP AT <a href="http://WWW.BLUEROCKTOOLS.COM">WWW.BLUEROCKTOOLS.COM</a> OR FROM YOUR LOCAL RETAILER.</b>	<b>5</b>
<b><u>OPERATIONS</u></b>	<b><u>6</u></b>
<b><i>PURPOSE</i></b>	<b><i>6</i></b>
<b><i>OPERATIONAL PRINCIPLES</i></b>	<b><i>6</i></b>
<b><i>MACHINE COMPONENTS</i></b>	<b><i>6</i></b>
<b><i>TRANSPORTING THE MACHINE</i></b>	<b><i>7</i></b>
<b><i>RUNNING THE MACHINE</i></b>	<b><i>7</i></b>
<b><i>INSTALLING ANNULAR CUTTERS</i></b>	<b><i>9</i></b>
<b><u>TROUBLESHOOTING</u></b>	<b><u>11</u></b>
<b><u>GENERAL MAINTENANCE</u></b>	<b><u>12</u></b>
<b><u>OCCASIONAL MAINTENANCE</u></b>	<b><u>12</u></b>
<b><u>PARTS LIST</u></b>	<b><u>13</u></b>
<b><u>BREAKDOWN VIEW</u></b>	<b><u>14</u></b>

---

## Safety

**DO NOT USE THIS MACHINE UNLESS YOU HAVE READ THE OPERATING INSTRUCTIONS!**



Safety glasses must be worn at all times in work areas.



Appropriate footwear must be worn.



Safety gloves should be worn at all times and jewelry must not be worn.



Hard-hat must be worn while using machine.



Read operational manual prior to use.



Long and loose hair must be contained.



Close fitting/protective clothing must be worn.



Hearing protection should be worn when using this machine.



Dust mask must be worn while using this machine.

### PRE-OPERATIONAL SAFETY CHECKS

- Examine the power cord and plug for damage. This tool is supplied with a ground plug and must always be used with the proper grounded circuit.
- Examine the body of the machine and inspect for damage or defects.

### OPERATIONAL SAFETY CHECKS

- ONLY to be operated by qualified personal who have read instructions.
  - NOTE: Failure to read and follow instructions could result in electrical shock, fire, property damage and/or serious injury!
- DO ensure all non-essential people are clear of the immediate work area.
- DO keep body parts, clothing & power cords clear of turning/cutting pieces. Stay alert and use common sense when using this tool.

➤ DO allow machine to reach operating speed before starting a hole.
➤ DO unplug machine while changing or adjusting cutting bits so as not to accidentally turn machine on.
➤ DO remove adjusting keys or hex wrenches prior to turning the machine on.
➤ DO use cutting paste (instead of cutting oil) when using this drill in an inverted position to prevent oils from entering the electrical system and for ease of cutting.
➤ DO tie a loop in any extension cord connections to prevent cords coming apart and a loss of power.
➤ DO guard against electric shock by preventing body contact with grounded surfaces such as pipes, radiators, ranges, refrigerators, etc.
➤ DO be mindful that power tools can expose an operator to vibrations transmitted through contact with the machine. Prolonged exposure can lead to medical issues which should be discussed with a medical professional.
➤ DO tie in a drip loop in the power cord to prevent cutting fluid from running into the power receptacle.
➤ DO use a dust extraction system for cutting materials that create dust such as cast iron. The operator should also wear a protective respiratory device.
➤ DO NOT make adjustments to machine while the machine is running.
➤ DO NOT switch off the machine when it is under load, except in an emergency.
➤ DO NOT remove or modify grounding plug. Only to be used on a properly grounded circuit.
➤ DO NOT leave the machine running when not in use.
➤ DO NOT hold the work piece by hand or using body. Always mechanically clamp or secure work piece.
➤ DO NOT allow coolant oil to enter the machine's ventilation system.
➤ DO NOT operate machine outside of machine specifications.
➤ DO NOT touch moving parts while the machine is running as death or dismemberment could occur.
➤ DO NOT allow children or untrained personal to operate machine.
➤ DO NOT use this machine in the rain or a wet environment. If using outdoors, make sure the adhering surface is clean and dry.
➤ DO NOT operate in the presence of explosive materials as power tools create sparks which may ignite dust or fumes.
➤ DO NOT drill into an area that may contain a live electrical wire/circuit.
➤ DO NOT operate this machine on the same work surface where welding is being performed. This could result in severe damage to the machine or personal injury to the user.
➤ DO NOT use this machine without the safety chain or safety strap.

- **DO NOT** operate this machine on a lower voltage as it may result in the electromagnet being at a reduced power level and the machine could become unstable while cutting. This could also limit the motor life.

- **NOTE:** Use of long small gauge power extension cords can result in decreased voltage. As local voltages can vary, it may be a good idea to test the voltage at the end of the extension cord to ensure proper voltage requirements are met. You might also consult an electrician to make sure the length of cord matches up with the proper wire gauge for this size motor. Make sure to use outdoor cords when operating outdoors.

BLUEROCK® TOOLS

## Specifications

<i>ELECTRICAL DATA</i>	
Voltage	120V, 60Hz
Current	7.9 Amps
Motor Size	950W
Power Connection	US Standard 3 Prong Type B Plug

<i>MECHANICAL DATA</i>	
Cutter Range	Annular Cutter: 7/16" Min to 1.5" Max (12mm - 35mm)
Cutting Depth	2" Max Depth
Cutting Speed	640 RPM One Speed Gearbox
Tool Holder	Direct Arbor with 3/4" Weldon Shank
Magnetic Adhesion	2600 Lbs (13000N)

<i>PHYSICAL DATA</i>	
Shipping Weight	30 Lbs
Machine Size	10" x 6" x 10"

## Included Accessories

<i>DESCRIPTION</i>	<i>QTY</i>
Instruction Manual	1
Coolant/Oil Bottle	1
Feed Handles (with two end caps)	1
Safety Chain	1
Plastic Case (for protection during shipping)	1
Hex Wrench	2

**Note**

**UPON RECEIPT, CHECK CAREFULLY TO ENSURE THAT THE MACHINE IS IN GOOD CONDITION AND HAS ALL ACCESSORIES LISTED ABOVE.**

**Additional Available Accessories**

Additional accessories for this machine can be found in BLUEROCK® Tools online shop at [www.bluerocktools.com](http://www.bluerocktools.com) or from your local retailer.

DESCRIPTION
13 Pc 2" Depth HSS Annular Cutter Set with Centering Pin
6 Pc 2" Depth HSS Annular Cutter Set with Centering Pin
6 Pc 1" Depth HSS Annular Cutter Set with Centering Pin



## Operations

### Note

**THOROUGHLY READ THROUGH THE ENTIRE MANUAL BEFORE OPERATING THIS MACHINE!**

#### PURPOSE


- The purpose of the TYP-28A is to drill through steel using annular cutters or 3/4" Weldon shank type drill bits.
- These drills are designed to magnetically adhere to a ferrous surface using their electromagnetic base. Generally these drills are designed and used to drill through mild steel. This magnetic base will not work without a power connection.
  - NOTE: The entire magnetic base must cover the work area to have full magnetic adhesion. Using only a portion of the magnet is dangerous! Make sure the base fits completely on the surface.
- These machines can be used vertically, horizontally or overhead (inverted) provided strong enough magnetic adhesion and an acceptable work environment. NOTE: For safety, the safety chain should always be used incase of an accidental power failure or other loss of magnetic adhesion.

#### OPERATIONAL PRINCIPLES

- The main drilling shaft rotates in the forward direction. The main drilling motor connects to the tool holder to make contact with a surface and slowly bore a hole. Using the feed handles on the side of the drill, the user can raise or lower the drilling motor.

#### MACHINE COMPONENTS

- The main components of the TYP-28A are the tool holder, gearbox, motor, frame and magnetic base. The tool holder is driven by the gearbox and the motor.
  - These components must be not be removed except by a qualified technician. Power must be disconnected prior to any service.

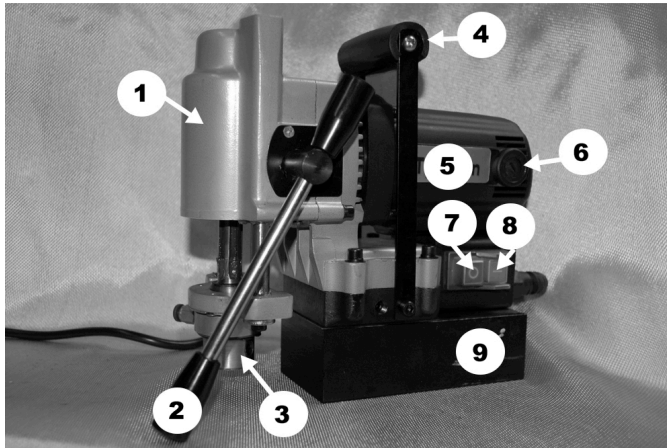

1) Gearbox
2) Feed Handle
3) 3/4" Weldon Shank Tool Holder
4) Machine Carrying Handle
5) Drill Motor
6) Brush Holder
7) Motor Off Switch
8) Motor On Switch
9) Magnetic Base

#### TRANSPORTING THE MACHINE

- When transporting the machine, always use the carrying handle.
- Ensure the drilling head is at the lowest position.
- DO NOT transport the machine with cutters or bits in the tool holder.
- If the coolant bottle is connected, ensure the valve is in the "off" position or the coolant has been drained.
- If transporting inside a vehicle, it is recommended to transport it on its side so as to avoid the item falling over.
- If possible, transport in a case.
- DO NOT carry the machine by the cord.
- DO NOT allow the cord or plug to drag along the floor when transporting.

#### RUNNING THE MACHINE

- Do all pre-operational and operational safety checks from Chapter 1.
- Consider your security and stability as well as the orientation of the machine in the work area.
  - Consider the work surface material, condition, strength, density and rigidity. These factors directly affect the tools magnetic adhesion. Magnetic adhesion diminishes with thinner material and rough surface. Full magnetic spec'd adhesion is considered on 1" material. When using on material 3/8" or less, the drill should be mechanically clamped to the work-piece.
- After placing the machine in work area, connect the safety chain.
  - The safety chain should attach to the machine (preferably through the carrying handle) as well as attached to the work area in such a manner that prevents the machine from detaching or falling from the work area in the event of magnetic deactivation or lost adhesion.
- Ensure the feed handle is securely attached to the feed spindle.


➤	Ensure the work surface and bottom of magnet are free of debris, oil, etc.
➤	Select and set up oiling method or cutting pastes.
	<ul style="list-style-type: none"> <li>○ If drilling overhead or horizontal use cutting paste liberally applied to the cutting bit.</li> </ul>
➤	If using the machine horizontally with the oil bottle, connect bottle to the side of the machine using the two set screws located on the drill frame.
	<ul style="list-style-type: none"> <li>○ Connect the oil bottle tube into the side of the tool holder by firmly pressing in the hose.</li> </ul>
	<ul style="list-style-type: none"> <li> <ul style="list-style-type: none"> <li>▪ To remove the hose later, press in the plastic piece around the hose towards the tool holder while simultaneously pulling the plastic hose away from the tool holder.</li> </ul> </li> </ul>
	<ul style="list-style-type: none"> <li>○ Make sure the oil bottle valve is in the off position.</li> </ul>
	<ul style="list-style-type: none"> <li> <ul style="list-style-type: none"> <li>▪ This is generally at a 90 degree angle from the valve hose.</li> </ul> </li> </ul>
	<ul style="list-style-type: none"> <li>○ Fill the oil bottle with cutting fluid.</li> </ul>
➤	Select appropriate size annular cutter or Weldon type twist drill bit.
	<ul style="list-style-type: none"> <li>○ The 3/4" Weldon shank uses two Allen head bolts. The annular cutters will go in the shank and be secured on the two flat sides by the two Allen head screws. See next section below for more specifics on using annular cutters.</li> </ul>
➤	Plug the machine into power source.
	<ul style="list-style-type: none"> <li>○ Form a loose knot in the power cord close to the plug connection to prevent cutting fluid from running down the cord and into the power receptacle.</li> </ul>
➤	Engage the magnet by pressing the magnet on/off switch on the back of the machine.
	<ul style="list-style-type: none"> <li>○ Check that the machine is firmly attached to the work area.</li> </ul>
➤	Turn feed handle raising the cutter until the bit is above the work surface.
➤	Open the oil bottle valve to allow oil to come out to the work surface.
	<ul style="list-style-type: none"> <li>○ You may have to gently squeeze or shake the bottle to get the oil to start flowing.</li> </ul>
➤	Turn the machine on.
	<ul style="list-style-type: none"> <li>○ Start the machine by pressing the green "on" switch. Stop the machine by pressing the red "off" switch.</li> </ul>
➤	Very slowly engage the cutting bit with the material surface by lightly engaging the hand crank down towards the material.
➤	After about 1/16" of cutting has been achieved in the work surface, slightly more force can be applied. This will be the normal amount of force the rest of the hole.

	<ul style="list-style-type: none"> <li>NOTE: Do not force the hole. Let the machine do most of the work. Excessive physical effort should be avoided as it can cause damage to the machine or the user.</li> </ul>
	<ul style="list-style-type: none"> <li>If the unit jams in a hole, stop the drill immediately to prevent injury. Disconnect the drill from the power supply and loosen the cutter by turning drill spindle counterclockwise. Never attempt to free cutter by starting motor!</li> </ul>
➤	Make sure to keep the cutting material adequately lubricated.
➤	Ease up on feed pressure as the cutter starts breaking through the backside of the material.
	<ul style="list-style-type: none"> <li>Be mindful that the metal cutting slug can eject at a rapid rate, so be sure all is clear on the output side of this slug to prevent injury to persons or property.</li> </ul>
➤	Finish drilling the hole.
➤	Turn the motor off and disconnect power once the drill is safely back up in the non-drilling position.
	<ul style="list-style-type: none"> <li>Remove metal chips wrapped around cutter and tool holder. Use a leather glove or pliers as these metal pieces can be sharp.</li> </ul>
➤	Disconnect safety chain and move the drill to a new drilling location.

#### INSTALLING ANNULAR CUTTERS

➤	WARNING: Annular cutters are extremely sharp and should only be handled with a thick glove so as not to cut the user during installation or removal.
➤	Check that the cutters are sharp and not damaged.
	<ul style="list-style-type: none"> <li>Annular cutters that are dull or damaged should not be used.</li> </ul>
➤	Make certain the machine is unplugged from power.
➤	Raise the tool holder to ensure ample room to install the cutter.
➤	Insert the annular cutter into the 3/4" adapter.
➤	Align the two "flat" sides of the annular cutter with the flat sides of the adapter.
	<ul style="list-style-type: none"> <li>CAUTION: Make certain the hex screw is seated into the flat side and not simply on the round side of the cutter shank.</li> </ul>
➤	Tighten one of the hex screws while slowly rotating the cutter forward and backwards.
	<ul style="list-style-type: none"> <li>Continue to tighten the screw until fully tightened.</li> </ul>
➤	Tighten the 2 <sup>nd</sup> hex screw.
➤	The annular cutter is ready to use.

**TYP-28A MAG DRILL**

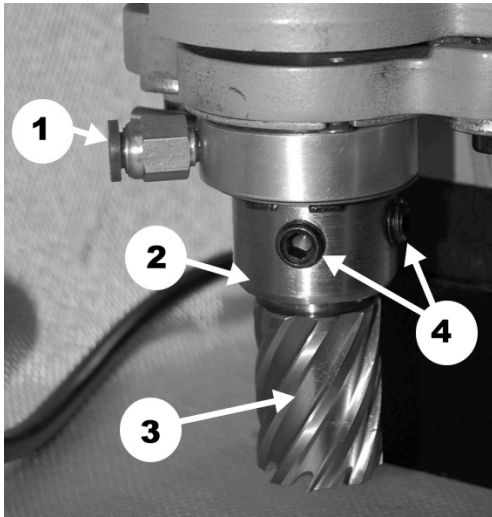

1) Oil Bottle Input
2) 3/4" Weldon Shank Tool Holder
3) Annular Cutter (not included)
4) 3/4" Adapter Hex Set Screws (2 total)

BLUEROCK® TOOLS

## Troubleshooting

### Note

**SERVICING SHOULD ONLY BE DONE BY A QUALIFIED TECHNICIAN.**

**DON'T FORGET TO UNPLUG POWER TO UNIT PRIOR TO SERVICE!**

PROBLEM	SOLUTION
Motor does not turn on.	<ol style="list-style-type: none"> <li>1) Check external power source (extension cord, breaker, etc).</li> <li>2) Loose internal wire. Check and secure if necessary.</li> <li>3) Motor brushes defective. Replace if necessary.</li> <li>4) Check to ensure the motor on/off switch is operable. Replace if necessary.</li> </ol>
Excessive sparking when motor is running.	<ol style="list-style-type: none"> <li>1) This may indicate the presence of debris in the motor or worn out carbon brushes. Check the brushes for unusual wear and replace if necessary. Clean out the internal motor armature if necessary.</li> <li>2) Armature has a rough edge. Inspect and replace if necessary.</li> </ol>
Magnetic does not hold to work area.	<ol style="list-style-type: none"> <li>1) Work surface thickness is too small. A minimum of 3/8" (10mm) continuous ferrous steel must be used for magnetic adhesion. CAUTION: These drills do not work on sheet metal!</li> <li>2) Entire magnet base is not on the work surface.</li> <li>3) Voltage is low at the machine. Check voltage.</li> <li>4) There is debris or excess material between the work area and the magnetic base. Clean work area surface.</li> </ol>
Hole is not cutting.	<ol style="list-style-type: none"> <li>1) Cutter is dull. Sharpen or replace.</li> <li>2) Work area material is not appropriate for cutter type. High carbon type steels require special cutting bits (tungsten carbide tip, etc).</li> </ol>

## General Maintenance

➤	Inspect electrical cords and electrical connections.
➤	Keep machine clean and free of debris.
➤	Periodically check and lubricate the drilling spindle as necessary using molybdenum grease.
➤	Check for misalignment, binding and breakage of all moving parts. If damaged, repair tool before use.
➤	Keep cutting tools sharp and clean. Sharp cutters are less likely to bind and are easier to control.

## Occasional Maintenance

➤	Have the power tool serviced by a qualified service technician using identical replacement parts.		
	○	Change motor brushes:	
		1)	Disconnect drill from power.
		2)	Unscrew left and side brush holder caps.
		3)	Take out old brushes.
		4)	Replace with exact same size new brushes.
		5)	Screw in brush holder caps tightly.

## Parts List

1.	Catch spring	27.	Catch spring	53.	Axle cap	79.	Oil bottle
2.	Spring stop	28.	Gear stop	54.	Handle	80.	
3.	Spring	29.	M5x6 screw	55.	Flexible cable	81.	
4.	Catch spring	30.	Gear	56.	Cable protector	82.	
5.	Oil hold	31.	Bearing	57.	Cable hold	83.	
6.	Catch spring	32.	Gera box cap	58.	Magnetic switch	84.	
7.	M8x10 screw	33.	M6x30 screw	59.	M4x12 screw	85.	
8.	Spindle	34.	Bearing	60.	Plate	86.	
9.	Bearing	35.	M6x12	61.	Electric bridge	87.	
10.	Catch spring	36.	Motor	62.	Induction	88.	
11.	M5x6 screw	37.	Bearing	63.	Capacity	89.	
12.	M6x12 screw	38.	Winder stop	64.	M6x12 screw	90.	
13.	Bearing stop	39.	M5x65 screw	65.	Motor switch	91.	
14.	Bearing hold	40.	Field core	66.	Switch holder	92.	
15.	Catch spring	41.	Motor hold	67.	M6x25 screw	93.	
16.	Catch spring	42.	M5x45 screw	68.	Cable connect	94.	
17.	Bearing	43.	Motor hold cap	69.	Slide key	95.	
18.	Rack	44.	Brush holder	70.	Slide key hold	96.	
19.	Internal spindle	45.	Brush	71.	Spring	97.	
20.	6x10 key	46.	Brush hold cap	72.	Machine hold	98.	
21.	Gear	47.	Bearing	73.	M10x20 screw	99.	
22.	Bearing	48.	Axle	74.	6x10 key	100.	
23.	Gear box	49.	3x10 key	75.	Plate	101.	
24.	Gear	50.	Gear	76.	Magnetic base	102.	
25.	3x10 key	51.	Gear cap	77.	5mm wrench	103.	
26.	Bearing	52.	M4x12 screw	78.	Safety strain	104.	



## Breakdown View

